



STAMP Tag Deploying Form

1.	Tagged by: _ Dave Hesler	
2.	Tag Number(s) (####):_Test Tag 0000c	
3.	Date: _June 8, 2023 Time :	11:10 (am) pm
	Tide level: High Medium Lo	w N/A
4.	Name of wreck (if known): N/A	
5.	Description: How did the wreckage reach its	present position?
	Float Uncovered X Other Was carrie	ed to Nature Center at
	Assateague State Park	
6.	Main Material of Construction: What is	Skip the following questions if
	the wreckage material?	not wooden wreckage
	X Wood \square Steel \square Iron \square Fiberglass	If the wreckage is wood, does it
		appear to be:
	S P 4 A A A A A A A A A A A A A A A A A A	1
	Check the following boxes if these details	☐ Hand hewn x Machine Cut
	are present on the wreckage:	☐ Both ☐ Other
	X Treenails	Look at the images on the
		instruction sheet and give your
	☐ Round Spikes x Other	best guess on what part of the
	Check the following boxes if the materials	shipwreck you believe you found.
	are present on the wreckage:	_Floor timber? Futtock?
	X Wood x Iron □ Copper □ Steel	
	X Iron spike concreted & staining	
l		

7.	7. Deterioration: What does the level of deterioration seem to be?			
0	No deterioration x Partially deteriorated Heavily deteriorated			
٥.	Exposure: Check the best choice for how exposed the wreckage is: x Completely exposed Partially exposed Nearly covered			
9.	Directions: Adjacent to the Nature Center along the trail to the beach at Assateague			
	State Park			
10. Estimated distance from the high tide line:				
	☐ below(ft) x above_10(ft)			
	beach zone x behind primary dune			
11	.GPS coordinates:			
Latitude:38° 13' 40" N Longitude:75° 8' 30" W				
12.Length/Width/Thickness of timber:				
	Length: _4' 9" Width: _9" _ Thickness: _9" _ Orientation: _redeposited (347°)			
	Diameter of wooden fasteners: 1.25"			
	Distance between 2 fasteners: 6"			
	Pictures: Test Tag 0000c 1 through Test Tag 0000c 5 Name/Id#)			
	(continue on back)			
13. Comments : _ <i>Teredo navalis</i> (shipworm) damage, iron spike corroded, 8 treenails, I double hole (empty).				
	Please send this completed form to susan.langley@maryland.gov with photos. Scans of the form or legible			

photos are acceptable or mail to: Dr. S. Langley, Maryland Historical Trust, 100 Community Place,


Crownsville, MD 21032.



Test Tag 0000c 1



Test Tag 0000c 2

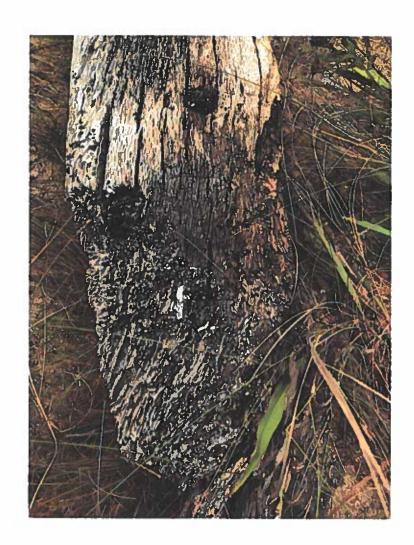

Test Tag 0000c 3



Test Tag 0000c 4



Test Tag 0000c 5